



GPS Rollover (2020-2022) To Affect Select Furuno Products

May 28, 2020
Service Advisory #2020-10T

Various Furuno units will be affected by GPS Rollover and other changes set to take place starting in November 2020. The following units may experience GPS positioning errors, incorrect date, or both of these issues. Devices impacted by GPS Rollover will still provide the correct GPS location, if the units are factory reset or power cycled, but the date will remain incorrect. It is recommended these legacy units be considered for replacement with newer comparable unit(s).

November 30, 2020		
Unit	Affected Core/Notes	Replacement
FELCOM70	GN79N INMARSAT Fleet 77 Service Discontinued	

December 20, 2020		
Unit	Affected Core/Notes	Replacement
FELCOM15/16	GN79L5A-N S/N before F15:3533-9471 S/N before F16:3534-2756 Software update may resolve. Update varies, depending on existing software	FELCOM18/19
FA100	GN79	FA170
GP310B	GH-79L2B-P Cold start may resolve for S/N 3453-5687 and after	GP330B

June 20, 2021		
Unit	Affected Core/Notes	Replacement
GP80	GN-8091C/D Replace GPS core with P/N 000-150-957 to resolve	GP170/ GP170D
GP90/DUAL	GN-8091C/D Replace GPS core with P/N 000-150-957	GP170/ GP170D
GP150/DUAL	GN-8091C/D Update software to latest release v4.025 to prevent	GP170/ GP170D
GP1640/F	GN-8091C/D	GP1871F/ GP1971F
GP1650W/ WD/WF/WDF	GN-8091C/D	GP1871F/ GP1971F
GP1850W/ WD/WF/WDF	GN-8091C/D	GP1871F/ GP1971F
GP32/37	GN-8091	GP39
GP320B	GN-8092C S/N 3473-6767 or older	GP330B
GP3500/F	GN-8091C/D, GN-8092C Software update pending (late 2020) to prevent	

January 2, 2022		
Unit	Affected Core/Notes	Replacement
FA150	GN-8093H Update transponder software to 4.07 to prevent	FA170
FELCOM15/16	GN-8097B/C/D F15 S/N 3533-9471 and after F16 S/N 3534-2756 and after	FELCOM18/19
FELCOM18/19	GN-8097B/C/D Older units require software v1.20 or higher	

If you have any questions, you may visit our website (www.FurunoUSA.com) and click on "Get Support," then "Ask a Question." You may also contact a Furuno support technician at either our Camas, WA facility, (360) 834-9300 or at our Denton, MD facility, (410) 479-4420.